




TURBINE PUMP CURVE

JAN. 15, 1970

SECTION
2120

102S

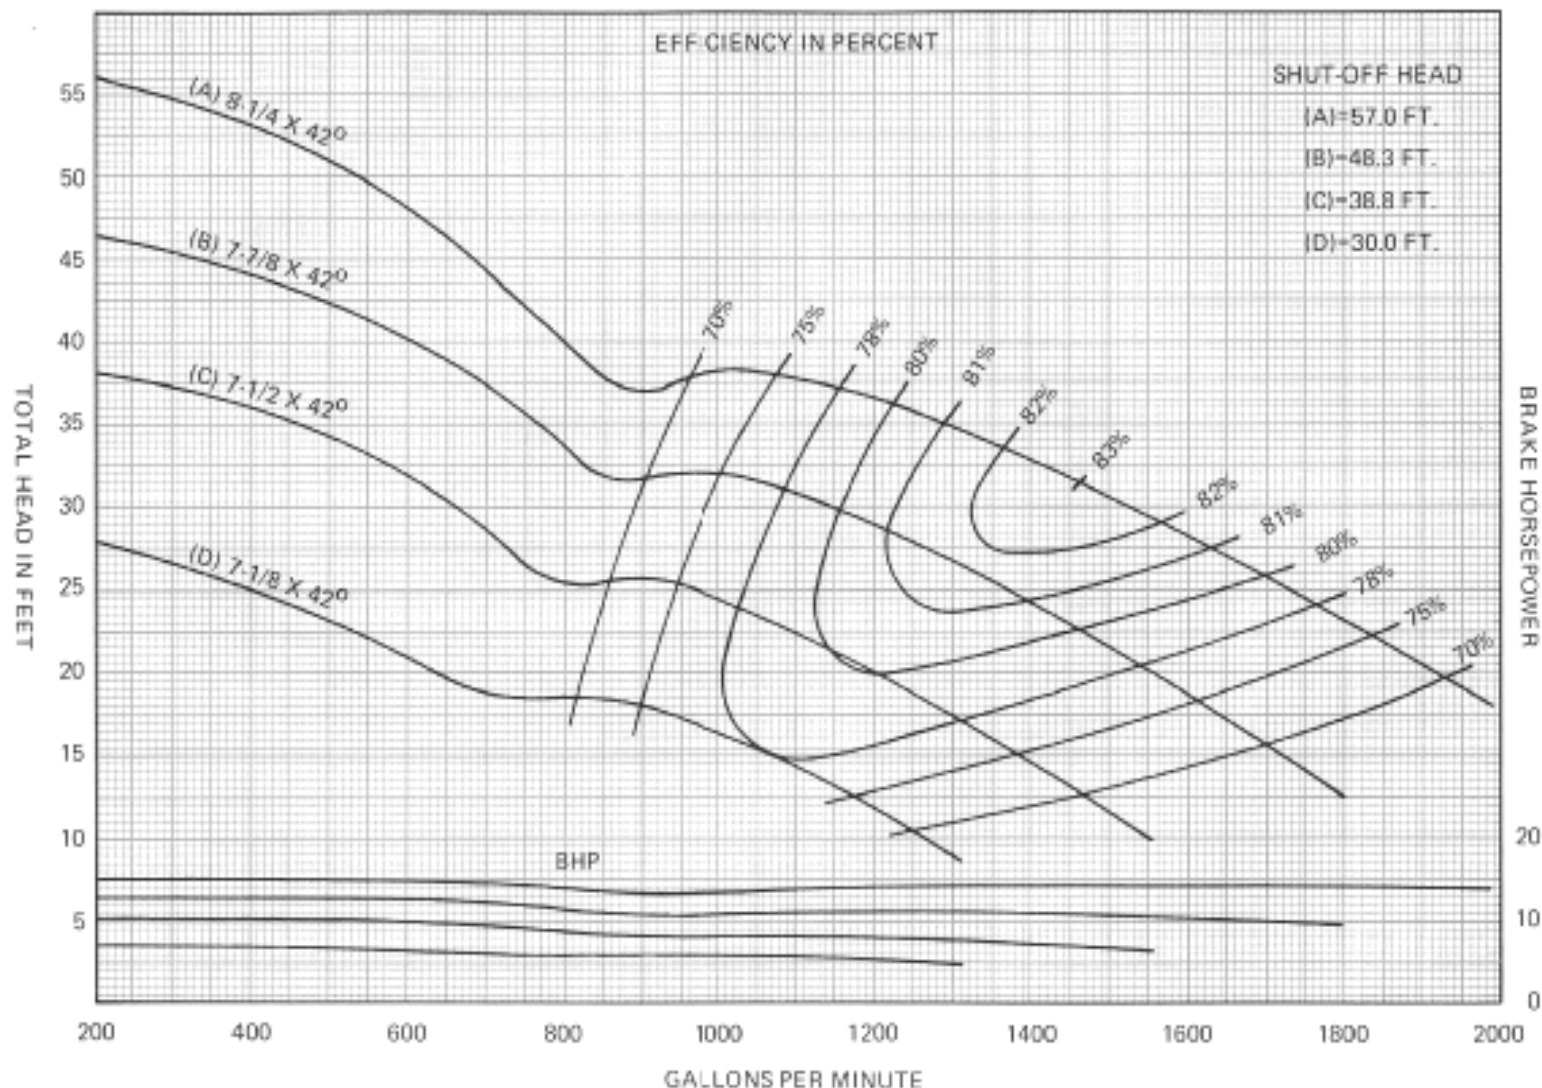

NUMBER OF BOWLS	CHANGE EFFICIENCY AS FOLLOWS
1	-5
2	-4
3	-2
4	-1

Change in efficiency may affect both head and horsepower

Bowl Dia.	9-1/2 In.
Bowl No.	3864-S, C.I., ENAM.
Impeller No.	3863, BRONZE
Eye Area	26.7 Sq. In.
Imp. Type	SEMI-OPEN K = 13.5

STAGE PERFORMANCE

Curve No.	102-6
R. P. M.	1760
Bowl	102S

Performance based on pumping clear, fresh water at a temperature not over 85°F., and free of gas, air or abrasives, and with bowls properly adjusted and submerged.