


BOWL T-80778

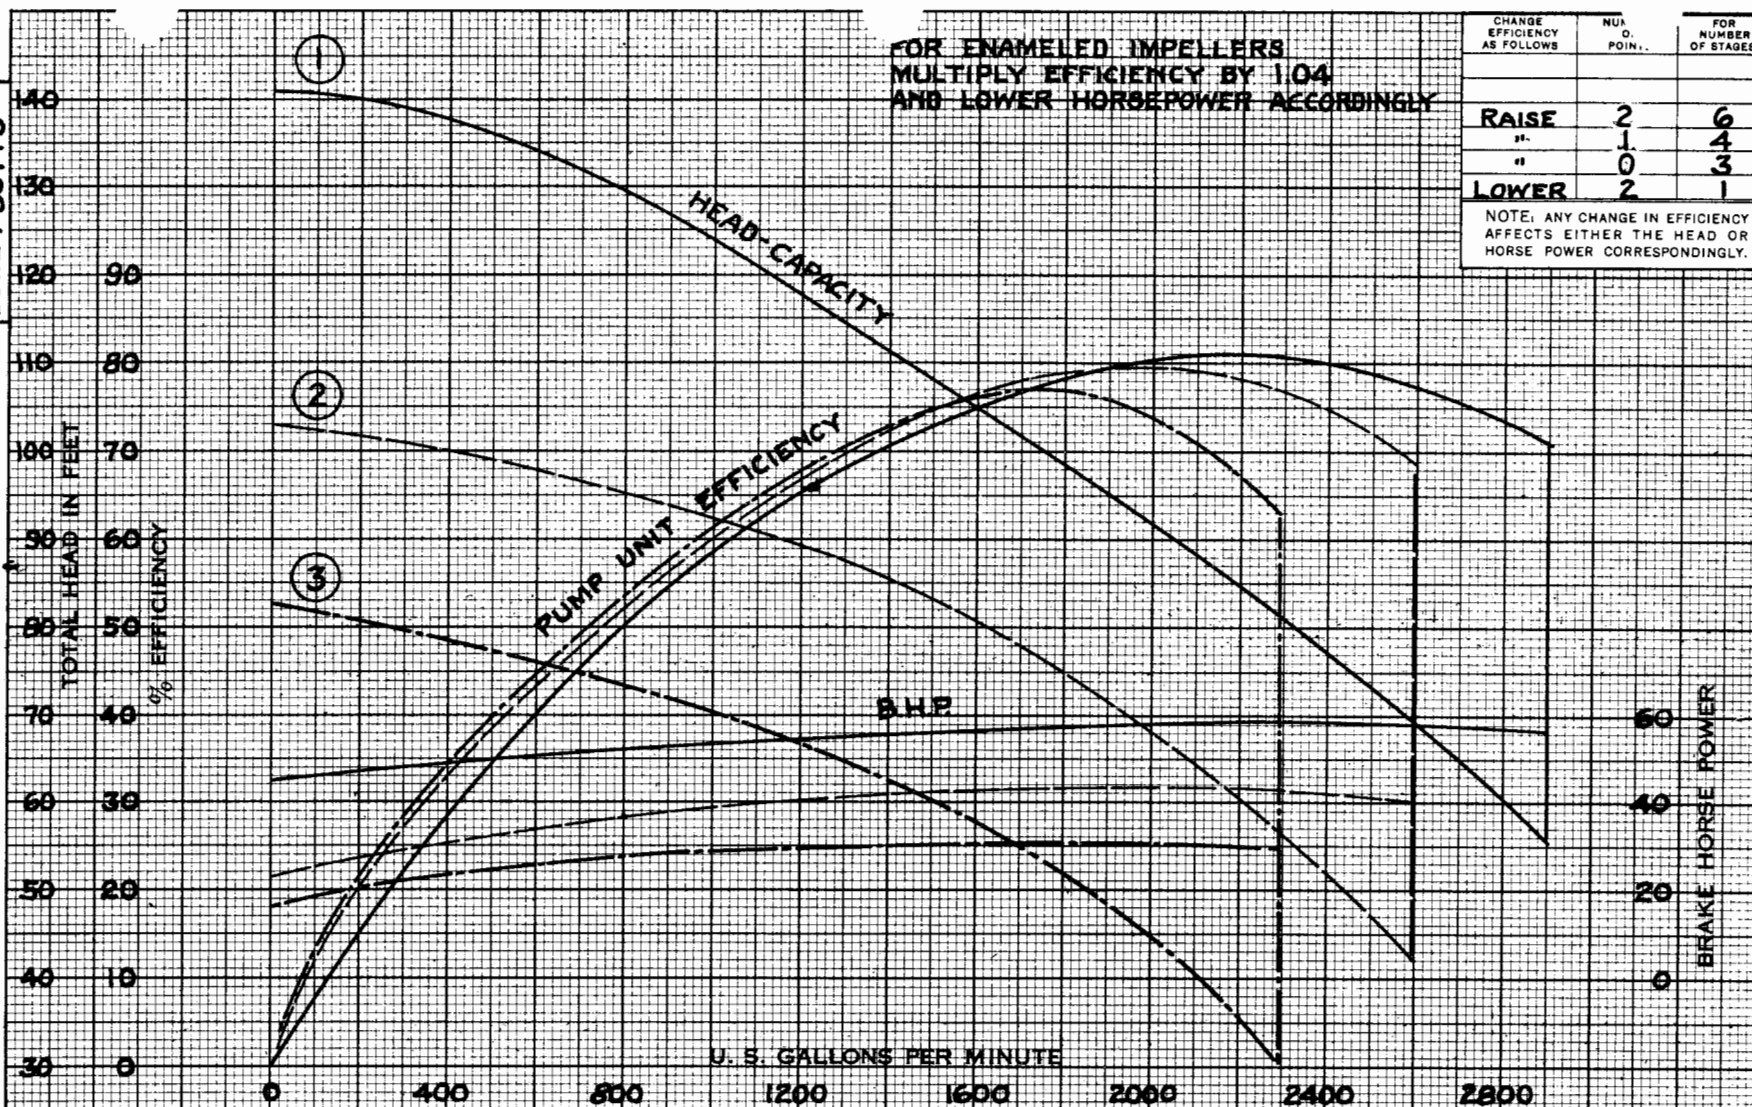

CHANGE EFFICIENCY AS FOLLOWS	NUM. O. POIN..	FOR NUMBER OF STAGES
RAISE	2	6
"	1	4
"	0	3
LOWER	2	1

NOTE: ANY CHANGE IN EFFICIENCY
AFFECTS EITHER THE HEAD OR
HORSE POWER CORRESPONDINGLY.

Section 11/0

TURBINE PUMPS

HYDRAULIC PERFORMANCE CONTINGENT ON WELL PROPERLY FURNISHING PUMP WITH THE AMOUNT OF NON-AERATED OR NON-GASEOUS WATER FREE FROM DETRITUS AT ANY HEAD ON THIS CURVE.	CURVE NO.	IMPELLER NO.	IMPELLER DIA.	TAKEN FROM
	1	T80166	11½	T345
	2	"	10 13/16	T362
	3	"	10	T364

PEERLESS PUMP DIVISION

FOOD MACHINERY CORPORATION
LOS ANGELES 31, CALIF.



PERFORMANCE PER STAGE

16M

DEEP WELL
TURBINE PUMP

1760

R. P. M.

SHEET NO. R-428