




TURBINE PUMP CURVE

10HS
SECTION
2120
JAN. 15, 1970

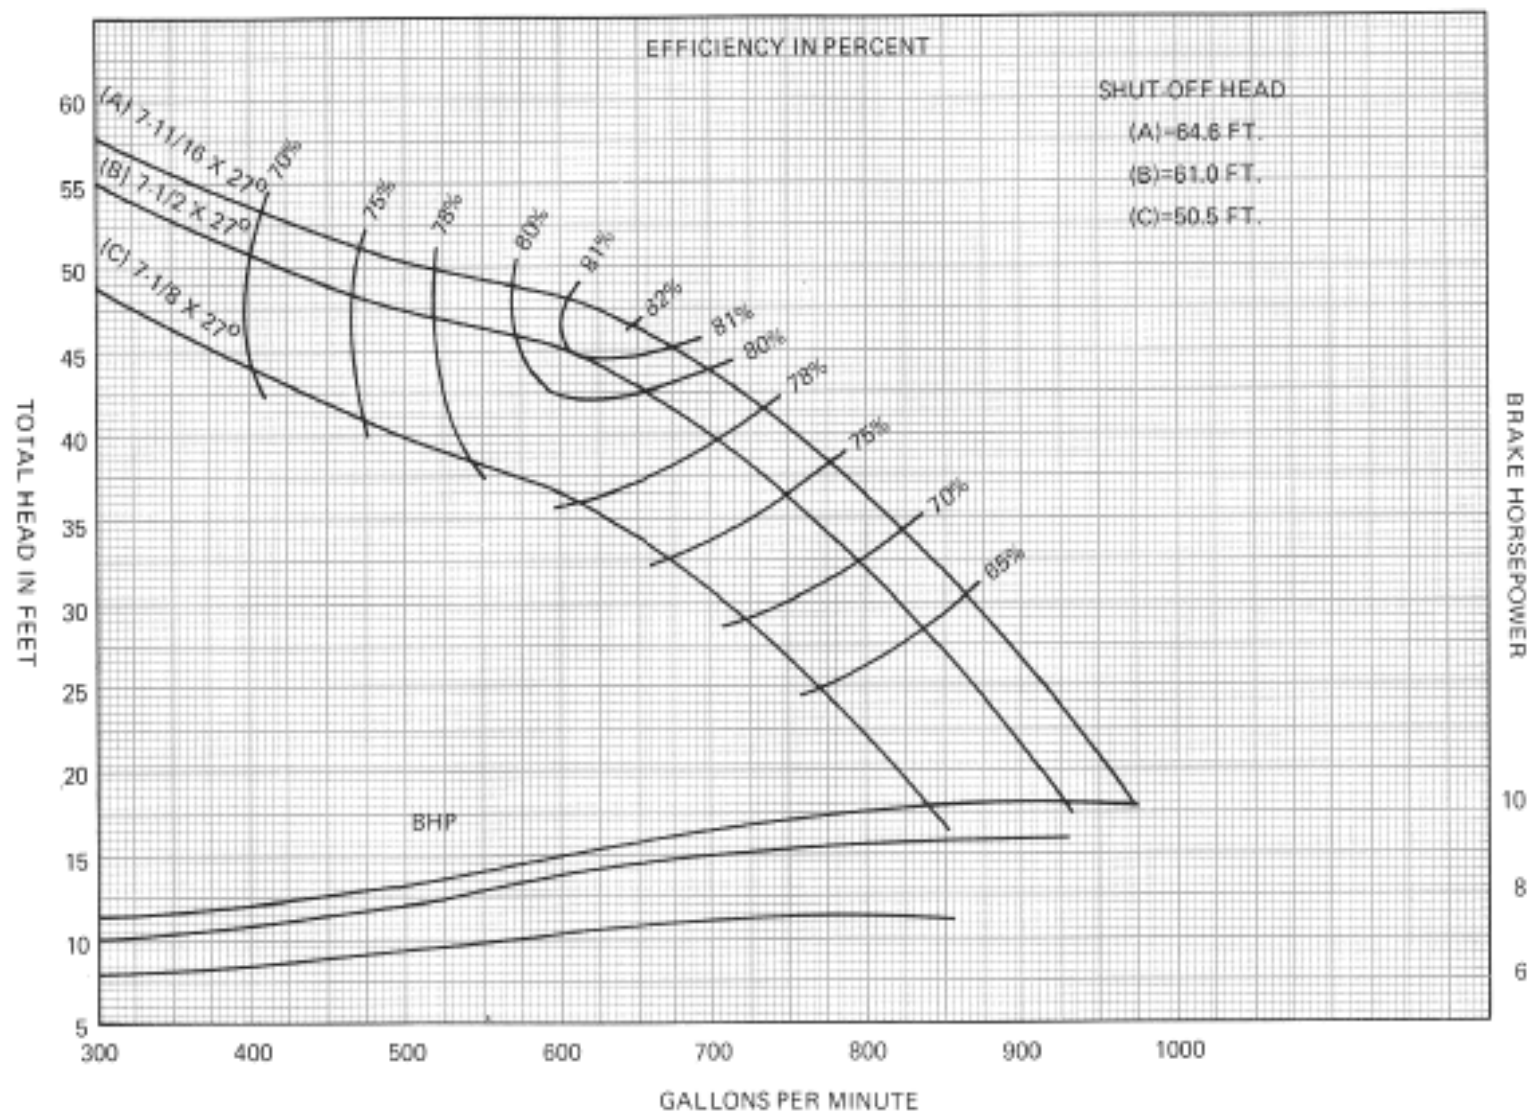

NUMBER OF BOWLS	CHANGE EFFICIENCY AS FOLLOWS
1	-4
2	-2
3	-1

Change in efficiency may affect both head and horsepower

Bowl Dia.	9-1/4 In.
Bowl No.	2968-S, C.I., ENAM.
Impeller No.	2969, BRONZE
Eye Area	14.9 Sq. In.
Imp. Type	SEMI-OPEN K = 9.2

STAGE PERFORMANCE

Curve No.	10H-82
R. P. M.	1760
Bowl	10HS

Performance based on pumping clear, fresh water at a temperature not over 85°F., and free of gas, air or abrasives, and with bowls properly adjusted and submerged.