




TURBINE PUMP CURVE

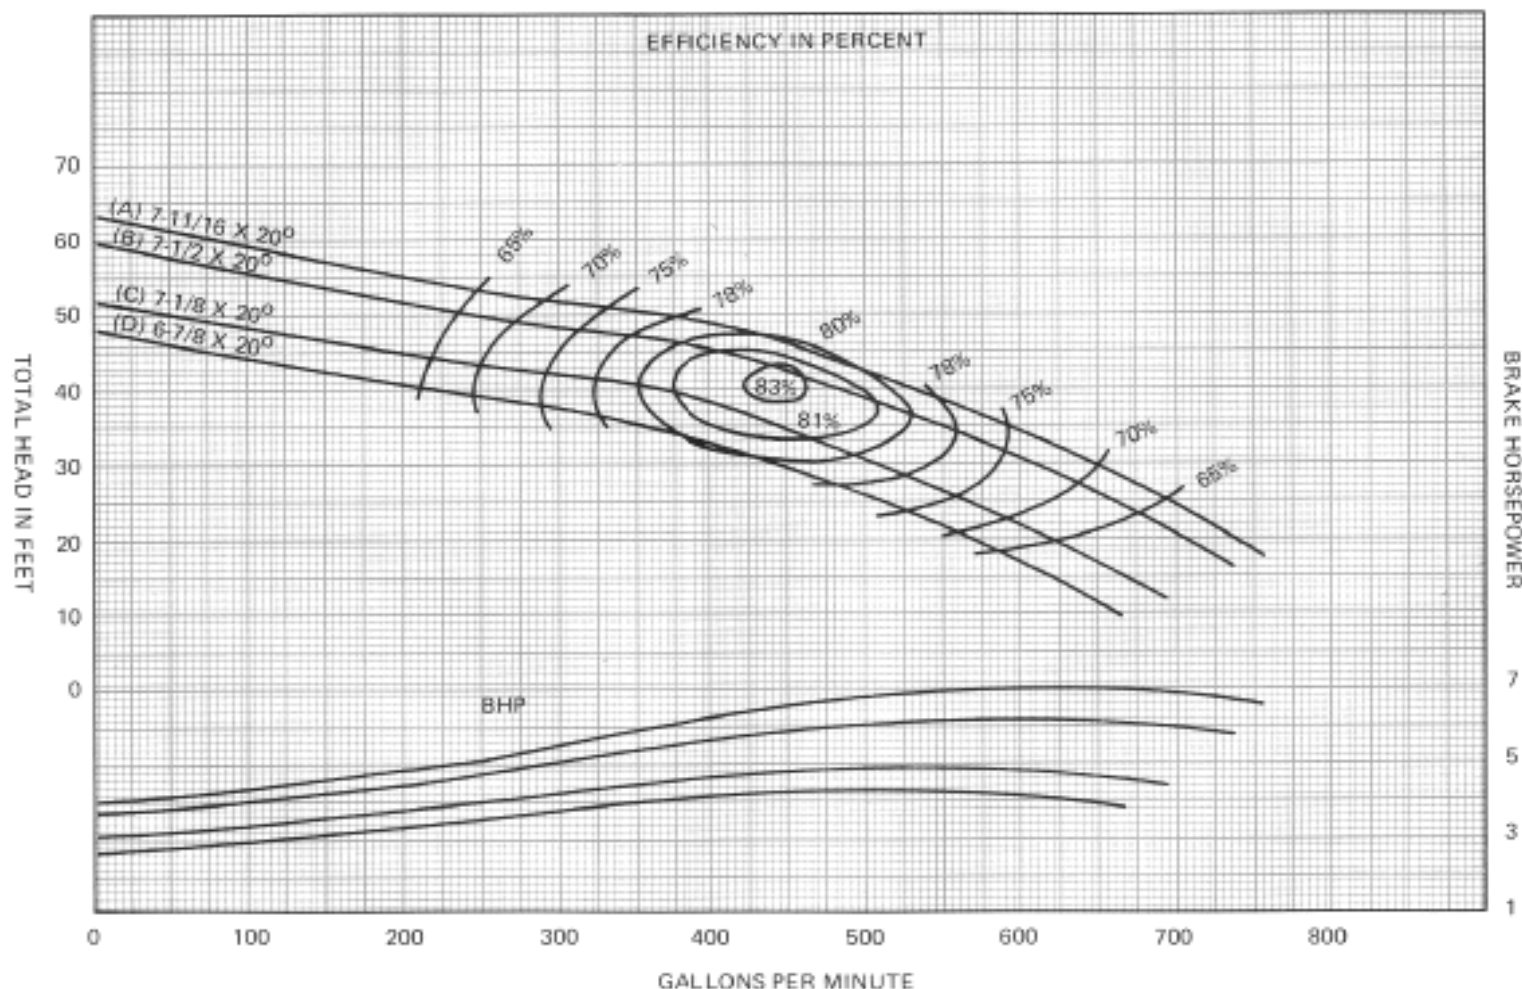

NUMBER OF BOWLS	CHANGE IN EFFICIENCY AS FOLLOWS
1	-4
2	-2
3	-1

Change in efficiency may affect both head and horsepower

Bowl Dia.	9-1/4 In.
Bowl No.	3090, C.I., ENAM.
Impeller No.	3102, BRONZE
Eye Area	10.17 Sq. In.
Imp. Type	CLOSED K = 6.6

STAGE PERFORMANCE

Curve No.	10L-26
R. P. M.	1760
Bowl	10LC

Performance based on pumping clear, fresh water at a temperature not over 85°F., and free of gas, air or abrasives, and with bowls properly adjusted and submerged.

10LC
SECTION
2120
JAN. 15, 1970