




TURBINE PUMP CURVE

10LS
SECTION
2120
JAN. 15, 1970

EFFICIENCY IN PERCENT

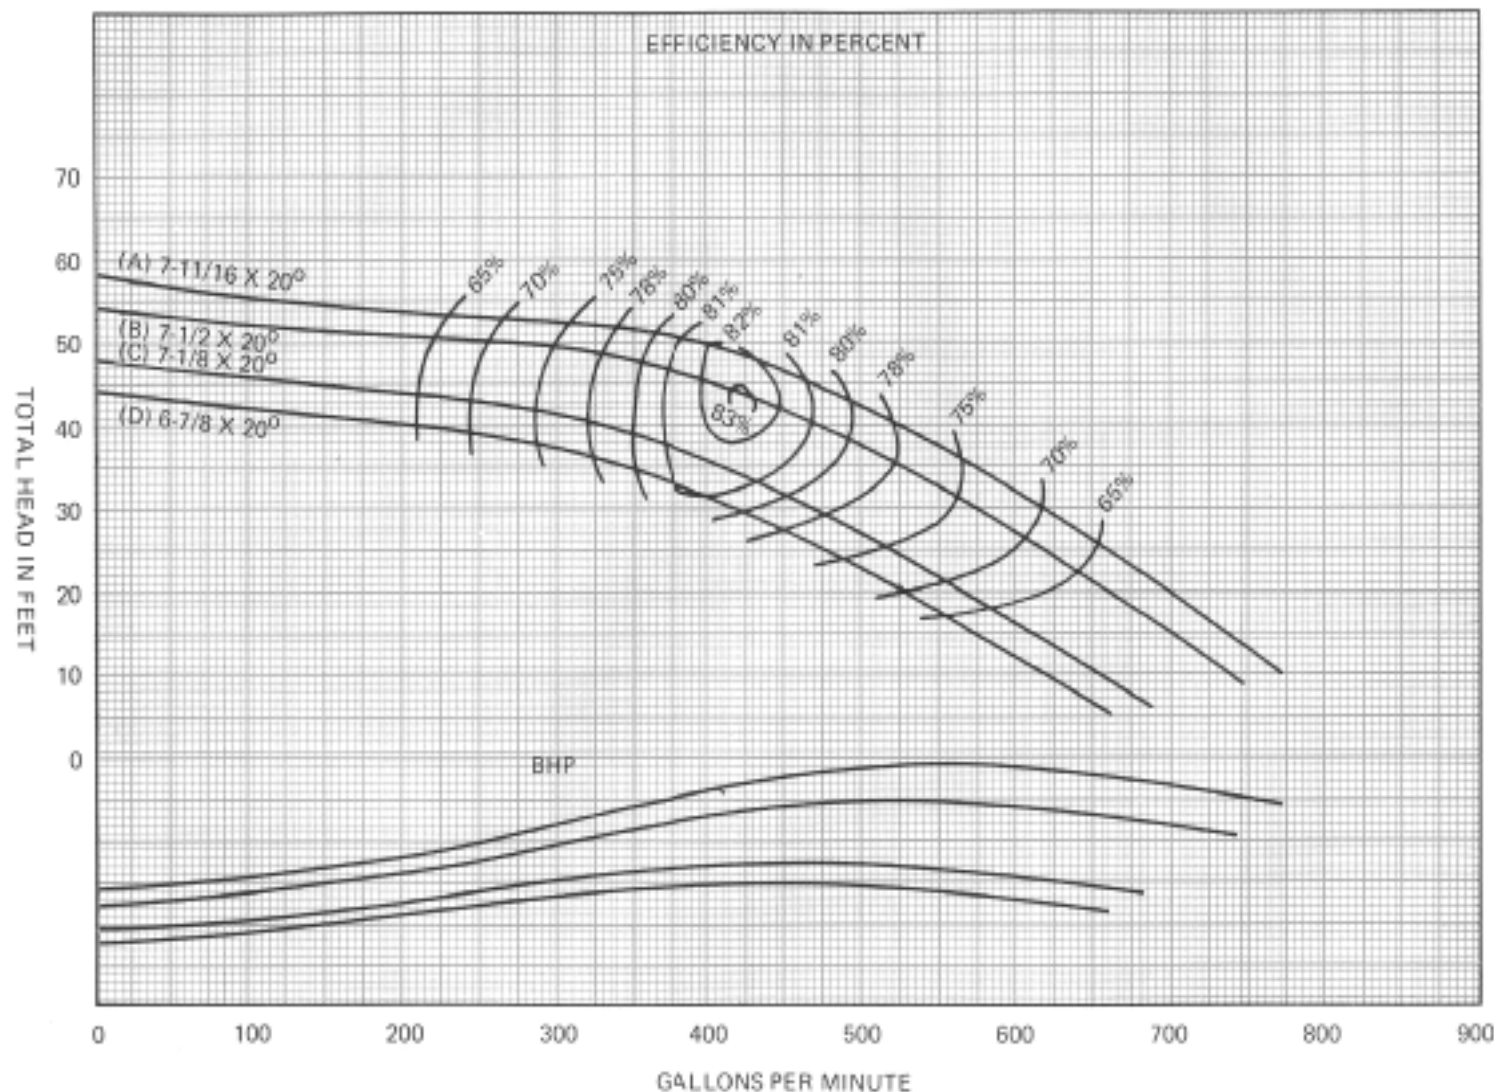

NUMBER OF BOWLS	CHANGE EFFICIENCY AS FOLLOWS
1	-4
2	-2
3	-1

Change in efficiency may affect both head and horsepower

Bowl Dia.	9-1/4 In.
Bowl No.	3098-S, C.I., ENAM.
Impeller No.	3103, BRONZE
Eye Area	11.74 Sq. In.
Imp. Type	SEMI-OPEN K = 7.5

STAGE PERFORMANCE

Curve No.	10L-30
R. P. M.	1760
Bowl	10LS

Performance based on pumping clear, fresh water at a temperature not over 85°F., and free of gas, air or abrasives, and with bowls properly adjusted and submerged.

BRAKE HORSEPOWER

7

5

3

1

GALLONS PER MINUTE