




TURBINE PUMP CURVE

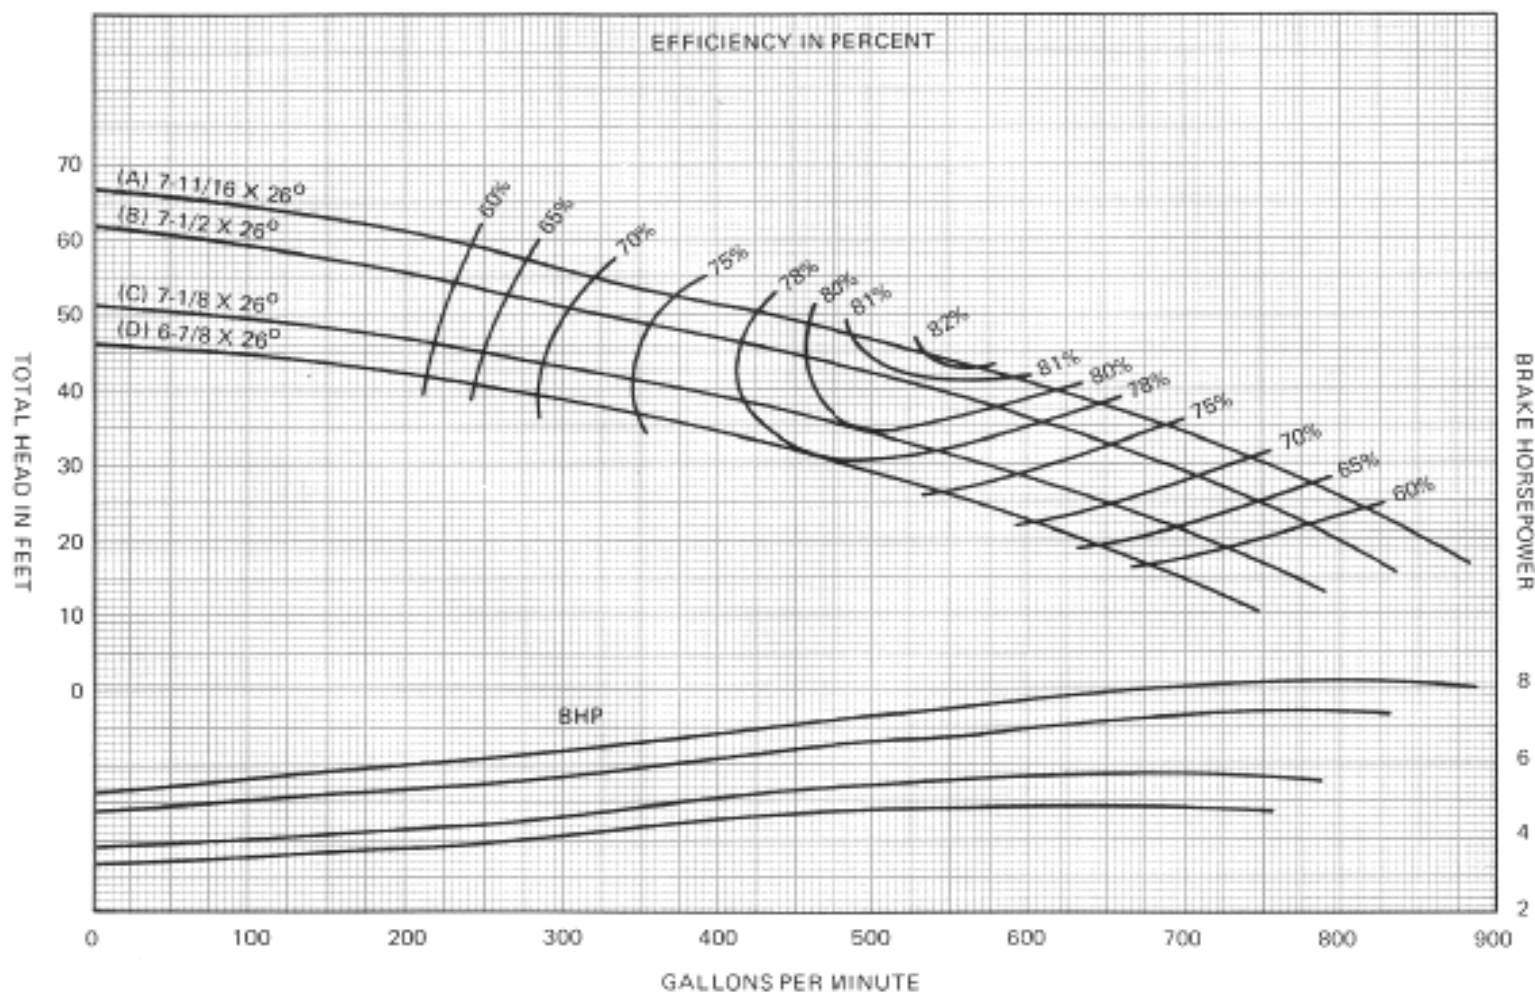

NUMBER OF BOWLS	CHANGE EFFICIENCY AS FOLLOWS
1	-5
2	-2
3	-1

Change in efficiency may affect both head and horsepower

Bowl Dia.	9-1/4 In.
Bowl No.	3098, C.I., ENAM.
Impeller No.	3097, BRONZE
Eye Area	11.74 Sq. In.
Imp. Type	CLOSED K = 6.6

STAGE PERFORMANCE

Curve No.	10M-41
R. P. M.	1760
Bowl	10MC

Performance based on pumping clear, fresh water at a temperature not over 85°F., and free of gas, air or abrasives, and with bowls properly adjusted and submerged.

10MC
SECTION
2120
JAN. 15, 1970