




TURBINE PUMP CURVE

10YS
SECTION
2120
JAN. 15, 1970

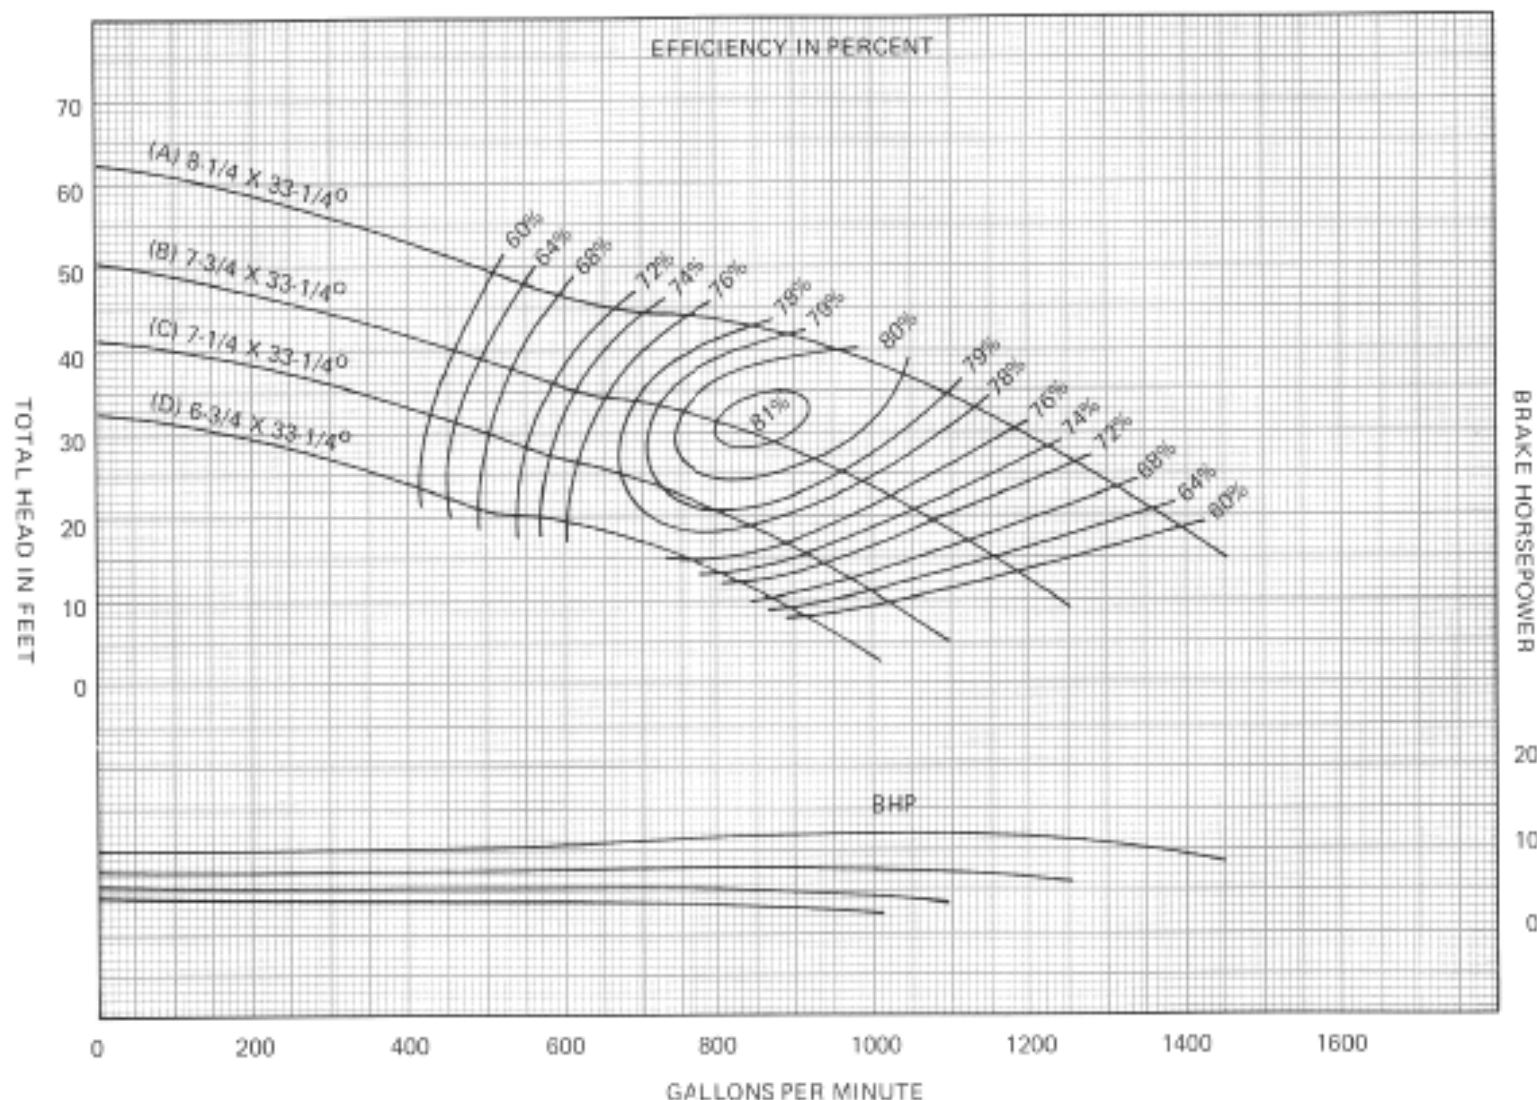

NUMBER OF BOWLS	CHANGE EFFICIENCY AS FOLLOWS
1	-4
2	-2
3	-1

Change in efficiency may affect both head and horsepower

Bowl Dia.	9-1/2 in.
Bowl No.	3541, C.I., ENAM.
Impeller No.	3542, BRONZE
Eye Area	19.4 Sq. in.
Imp. Type	SEMI-OPEN K = 11.4

STAGE PERFORMANCE

Curve No.	10Y-3
R. P. M.	1760
Bowl	10YS

Performance based on pumping clear, fresh water at a temperature not over 85°F., and free of gas, air or abrasives, and with bowls properly adjusted and submerged.