


CHANGE EFFICIENCY AS FOLLOWS	NUMBER OF POINTS	FOR NUMBER OF STAGES
RAISE	2	6
LOWER	1	3
"	3	2
"	6	1

NOTE: ANY CHANGE IN EFFICIENCY AFFECTS EITHER THE HEAD OR HORSE POWER CORRESPONDINGLY

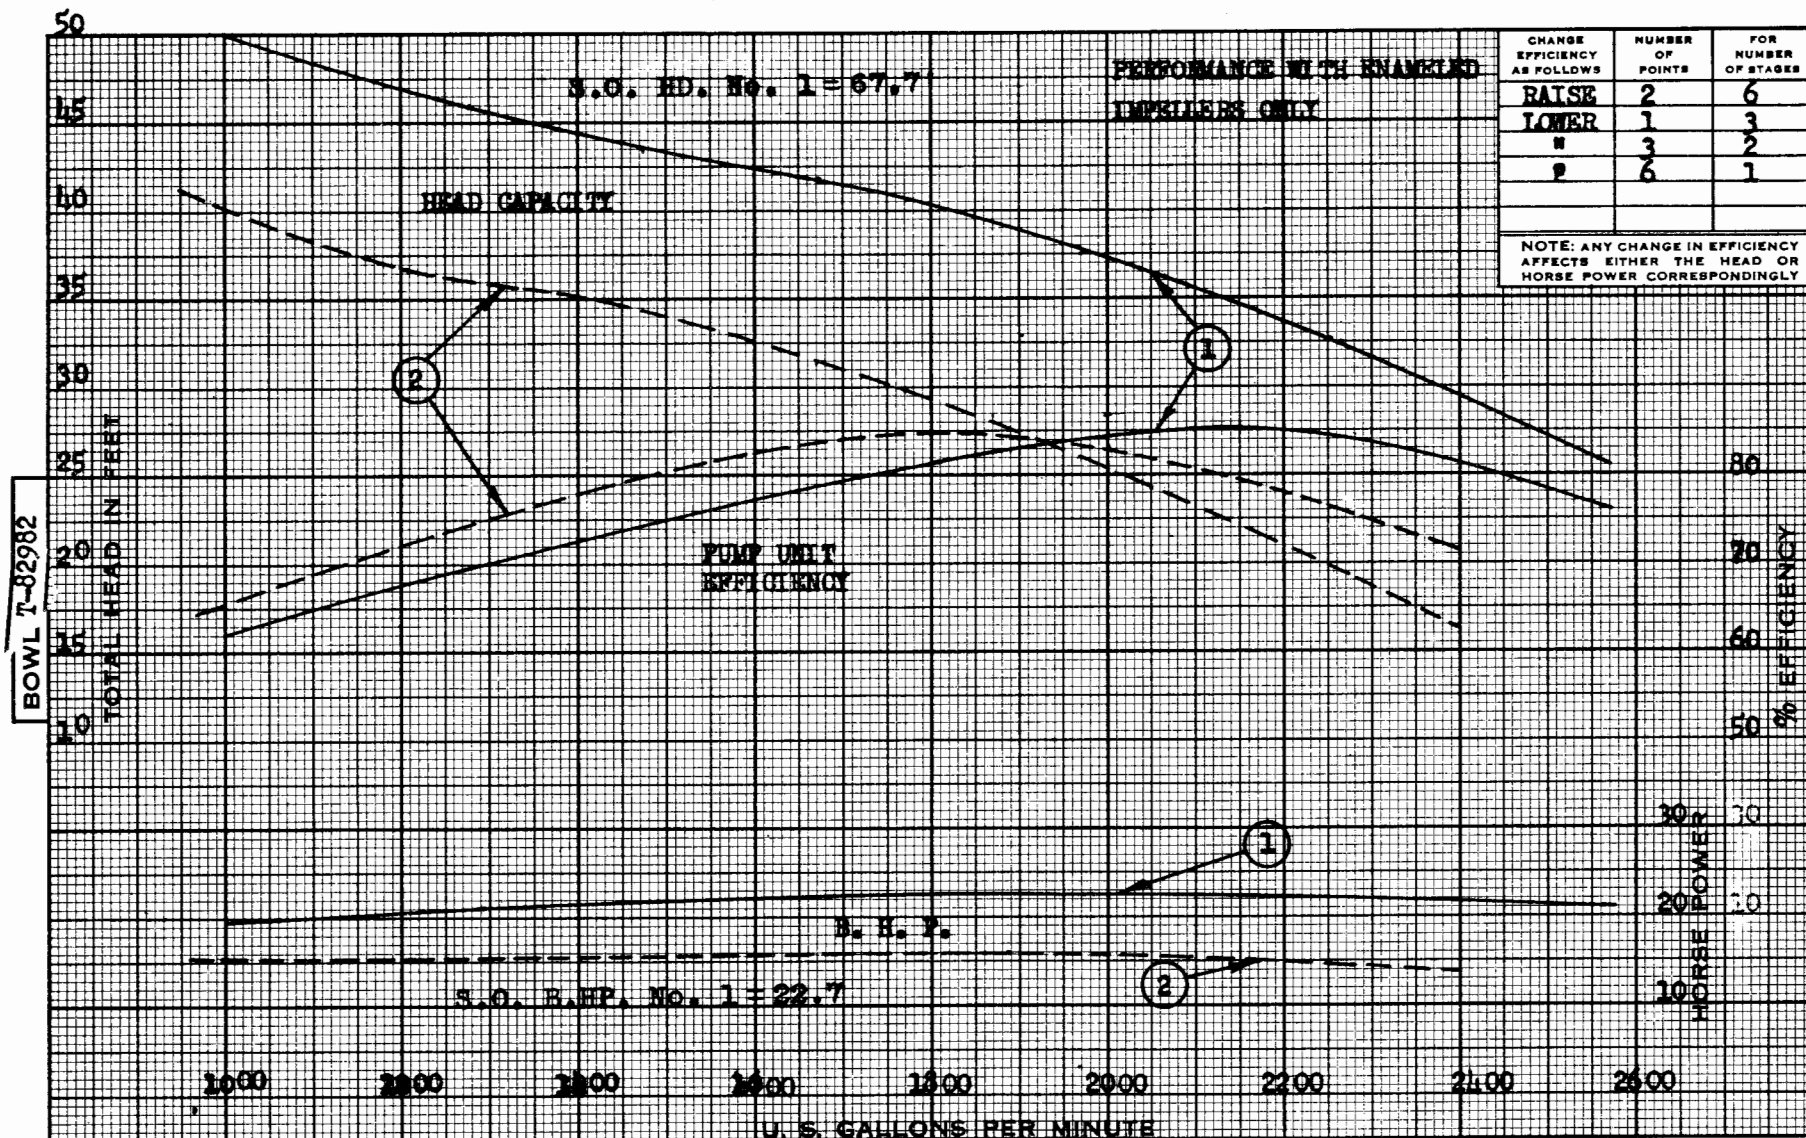

HYDRAULIC PERFORMANCE	CURVE NO.	IMPELLER NO.	IMPELLER DIA.	TAKEN FROM
GUARANTEED AT THE DESIGNATED POINT ONLY AND IS CONTINGENT ON WELL PROPERLY FURNISHING PUMP WITH NON-AERATED OR NON- GASEOUS WATER FREE FROM AB- RASIVES. PUMP BOWLS MUST BE PROPERLY ADJUSTED FOR THE HEAD AT WHICH THEY OPERATE AND MUST BE SUBMERGED.	1	T-83008-2	10 $\frac{1}{2}$ "x12"	20725
	2	T-83008-2	10"x11 $\frac{1}{2}$ "	20724
	3			

PEERLESS PUMP DIVISION

FOOD MACHINERY CORPORATION
LOS ANGELES 31, CALIF.



PERFORMANCE PER STAGE
DEEP WELL
16" MA TURBINE PUMP

1160

R. P. M.

SHEET NO. R-1354