




Fairbanks Morse Pump

No. Stages	Eff. Change	MATERIAL	Eff. Change
1	-3	IMP. - C.I.	-1
2	-1	IMP. - NI-RI	-1
3	0	BOWL - BRZ.	-3
4		BOWL - NI-R.	-3


7A

1750 R.P.M.

SINGLE STAGE LAB PERFORMANCE WITH STANDARD MATERIALS. EFFICIENCY SHOWN FOR 3 OR MORE STAGES. HORSE POWER SHOWN FOR ONE STAGE BASED ON 3 STAGES. EFFICIENCY CORRECTIONS SHOULD BE MADE FOR STAGE AND MATERIAL.

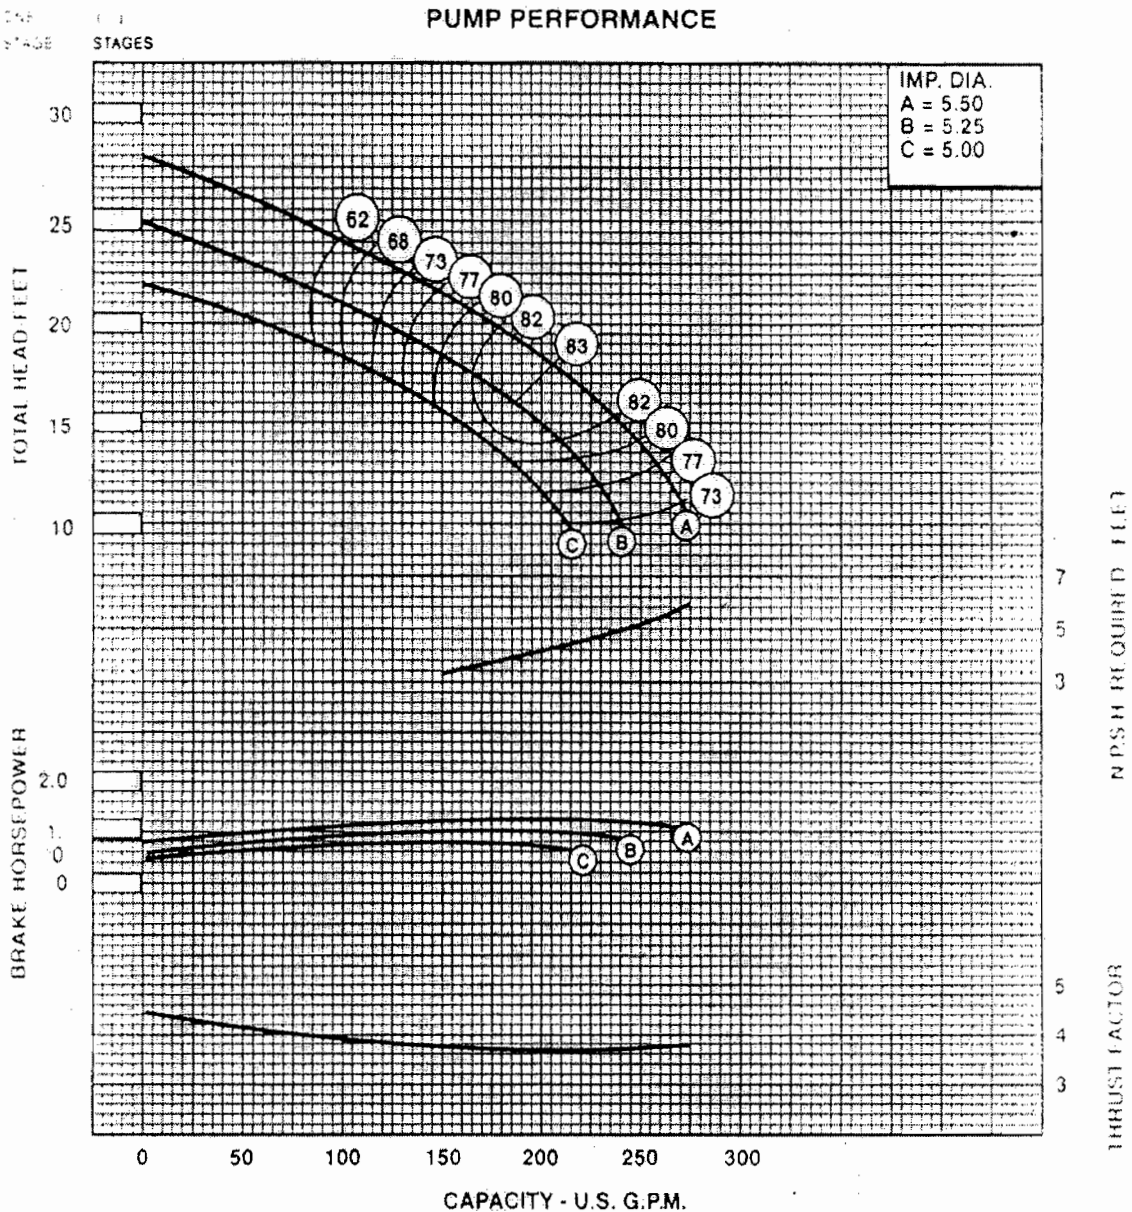

DISC AREA - SQ. IN.	= 7.56	IMPELLER WT. - LBS.	= 4.8
DR. PER IMPELLER - LB.-FT.	= 0.1	ONE STAGE WT. - LBS.	= 84
MAX. NO. STD. STAGES	= 19	ADD'L. STAGE WT. - LBS.	= 30
MAX. OPERATING - P.S.I.	= 400	DISCH. - IN.	= 8
STD. LATERAL - IN.	= 0.25	SUCTION - IN.	= 8
STD. SHAFT DIA. - IN.	= 1.00	BOWL CONN. - FLANGED - COLLET	
MAX. SUBMERGENCE - IN.	= 13	ADD 5-1/4" PER ADDITIONAL STAGE.	

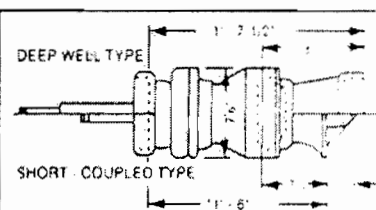

Curves reflect typical performance. Refer to catalog for details.